Index No. 3823098

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 32, Township 38, Range 23, 4TH P.M.

STATE OF MINNESOTA, County of KANABEC

At the corner location shown on the sketch:

found 1/2" iron pipe (R.L.S. #12236)

Kanabec County U.S. Survey Feet Coordinates
NAD 1983, HARN 1996 Adjustment
Obtained by RTK GPS Observation

Northing= 105584.48

Easting= 417151.59

Note: NAD 1983, HARN 1996 Adjustment coordinates are NOT compatible with NAD 1983 coordinates

Note: 1 Meter=3937/1200 U.S. Survey Feet

SKETCH OF REFERENCE TIES

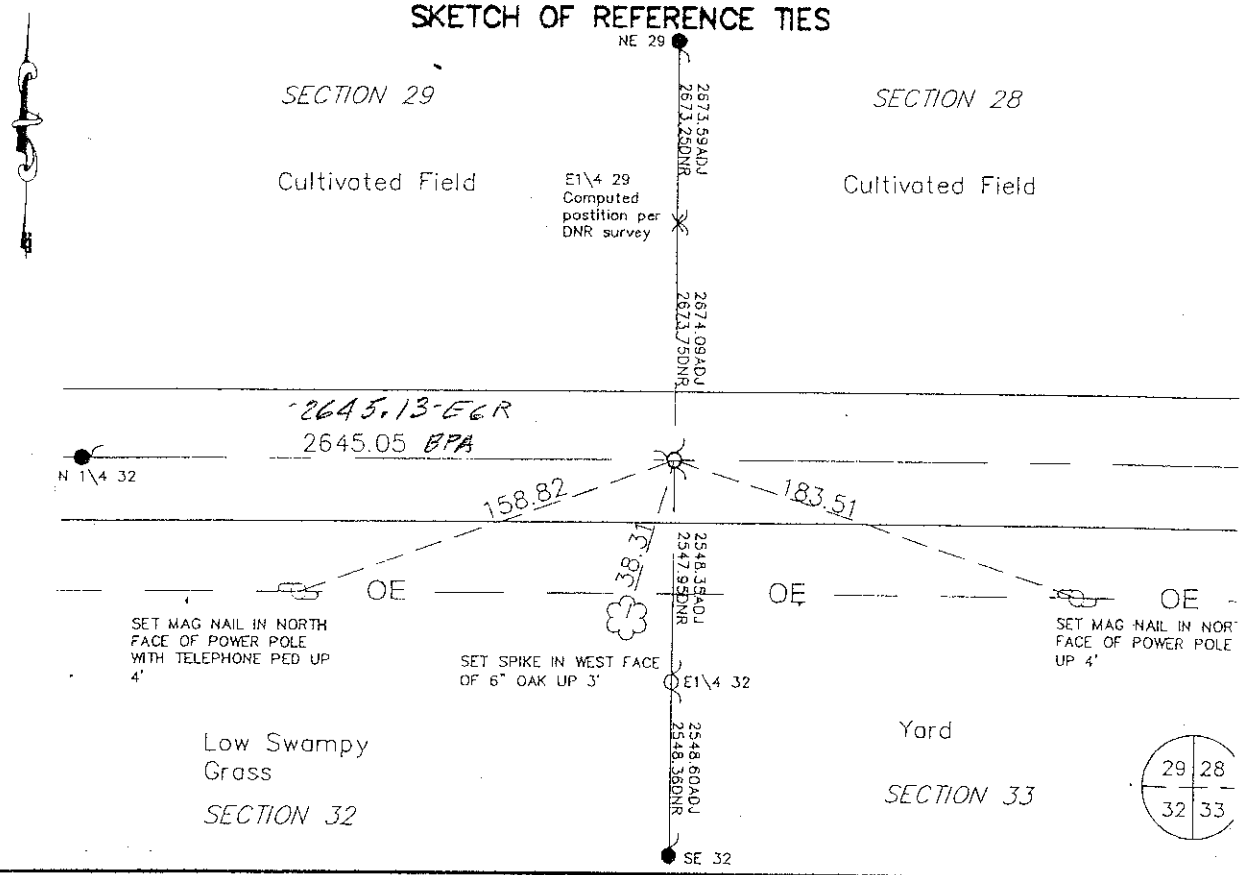

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Signature: Ernest T. Reed

Date: May 28, 2013

Registration No. 9808

[■] Land Surveyor, [ ] Professional Engineer

[ ] County Surveyor, [ ] County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Recorder's office at _____ M. on the _____ day of _____ A.D., 20____

County Recorder _____

BY _____ Deputy

DOCUMENT NO. _____

Statement of Evidence No. 3823098

Northeast Corner, Section 32

During the G.L.O. survey, a wood post was set to mark the corner. No bearing trees were noted but they noted level soil and timber consisting of sugar, basswood, butternut and elm.

In 1962, the Minnesota Department of Natural Resources, in a resurvey of Section 28 and 33 searched the area and placed a 1 inch iron pipe at the location of the corner. A distance of 5096.31 feet was measured from the Southeast Corner of Section 32 and 2547.95 feet was measured from the East Quarter Corner of Section 32. In addition, a distance of 5347.00 feet was measured from the Northeast Corner of Section 29 and a distance of 2673.75 feet to the East Quarter Corner of Section 29. The DNR noted the position of intersection of roads west and north. They also noted a 1 inch iron pipe at the Southeast Corner of Section 32 at a fence corner and a 1 inch iron pipe and the East Quarter of Section 32 at a fence corner.

In February of 2006, Bogart, Pederson, and Associates (BPA), a private surveying firm in Waite Park, Minnesota, in a private survey in Section 32 searched the area near the corner and nothing was found. The field crew noted a tree line extension south and centerline of a road running east and west at said corner. A Standard Cast Irion Monument was found at the Southeast Corner of Section 32 and an Aluminum Capped Monument was found at the Northeast Corner of Section 29. These two positions were referenced in the DNR survey of 1962. A distance of 10444.63 feet was measured between the aforementioned corners. The DNR noted a distance of 10443.31 feet between the same two corners. BPA prorated a distance and bearing from the DNR survey to set the position of said corner. The position of the corner fell on the tree line extension south and centerline of a road running east and west. A distance of 5096.95 feet was measured from the Southeast Corner of Section 32 and 5347.68 feet from the Northeast Corner of Section 29. A ½ inch iron pipe (R.L.S. #12236) was placed at this location and reference ties were recorded at this time.

On May 28, 2013 in a survey of Section 32 E.G. Rud & Sons found this ½ inch iron pipe, verified field ties and established Kanabec County Coordinates on this position.